
The ALF4 EXT-SMOKE message, is due to a smoke extractor speed anomaly (lower of the set value).

"ALF4" smoke extractor malfunction in STOVE STATS.

Cause A) No connection between the 3-pin terminal of the black-red-white cable of the ENCODER, the smoke extractor and the electronic board => Solution: Check the wiring and connections (see electrical diagram in appendix page 19) or replace the smoke extractor by (cod. RF02010400).

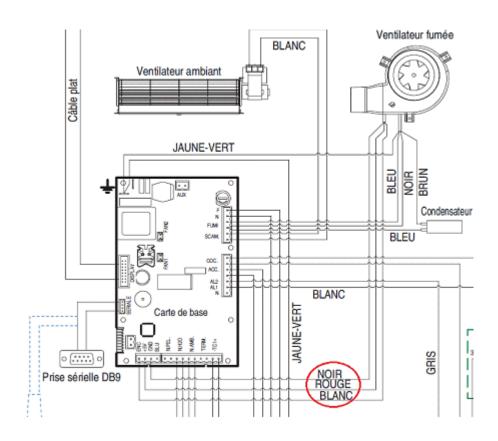

Cause B) Defective electronic board => Solution: Replace the electronic board.

Cause C) Wrong position of the black-red-white smoke probe on the electronic board => Solution: Make sure the probe is in the correct position (see wiring diagram in appendix page 19)

